

# *Expert Auto Appraisals, LLC*

720-453-0774

*EAppraisals.com*

*Date/Time/Appraisal #* \_\_\_\_\_



## *Vehicle Info:*

**Model:** Porsche      **Make:** Cayenne      **Trim Level:** GTS      **Year:** 2008

**Mileage:** 82,845 miles      **License No:** Dealership      **VIN Number:** \_\_\_\_\_

**Exterior:** Basalt Black Metallic      **Interior:** Savannah Beige Alcantara/Leather

**Transmission:** Automatic      **Engine:** 4.8 Direct Injection V8

---

**Owner/Buyer:** \*\*\*\* \*

**E-Mail Address:** \*\*\*\*\*

**Street Address:** \*\*\* \* \* \*

**City:** \*\*\*\*\*

**State:** CO

**Zip Code:** \*\*\*\*\*

**Day Telephone No:** 720-453-0774

## *Tires:*

**Brand:** Continental      **Speed Rating:** 107H

**Size:** 275/55/20      **Spare:** Compact - New

**Tread Depth:** LF 5/32" LR 4/32" RR 4/32" RF 4/32"

**Tire Age:** 2017

### **Condition:**

Overall good condition. All electronics, accessories, and features work correctly. Air suspension goes into each position correctly and holds position without suspension sag during inspection. Navigation, heated seats, all windows/locks, radio, sunroof, and cruise control all function correctly. Right quarter panel and rear bumper repainted/repaired, no frame damage evidence found. Small amount of "blow by" in the engine, Oil analysis ordered and results will be given ASAP. Transmission shifts smoothly and car tracks straight while driving with no unusual sounds or feelings. Locking rear differential and 4WD work correctly. Slight smoke odor in the interior. Rear spoiler is faded.

### **Exterior:**

Front bumper - Minor chips

Left rear door - Scuffs - 3-4"

Left quarter panel - Door ding - 1/4"

Rear bumper cover - Scuffs - 3-4"

Rear bumper cover - Previous repair/repaint - Acceptable

Right quarter panel - Previous repair/repaint - Acceptable

Rear wiper bolt cap - Missing

Rear spoiler - Faded clear coat

LR, RR, and RF Tires - Worn

Right front tire - Worn unevenly

Right front door - Door ding - 1/2"

Right front wheel - Scratched

Right rear wheel - Scratched

### **Paint reading/Previous Repairs:**

Rear Bumper - Previous Repair/Repaint - Acceptable, Light orange peel texture in paint

Right Quarter Panel - Previous Repair/Repaint - Acceptable, 1 dirt speck above wheel and very light sand marks in paint on panel. Tape line on inner quarter panel.

### **Mechanical:**

"Service Due" light is on

Engine - Blow by/Blow back - **Oil analysis ordered**

## Interior:

Light Smoke Odor

## Photos



1 Key Fob



Emission Sticker









Light pitting on chrome wheels





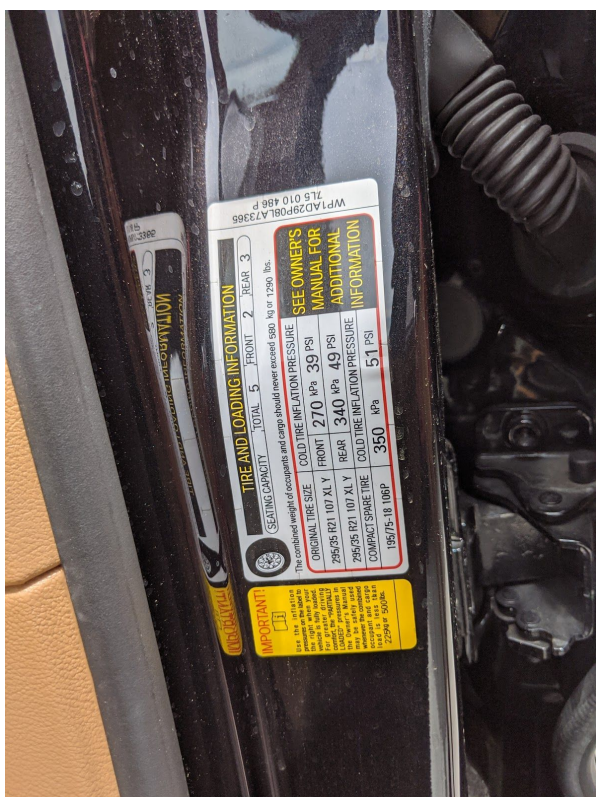

## Tire Sticker

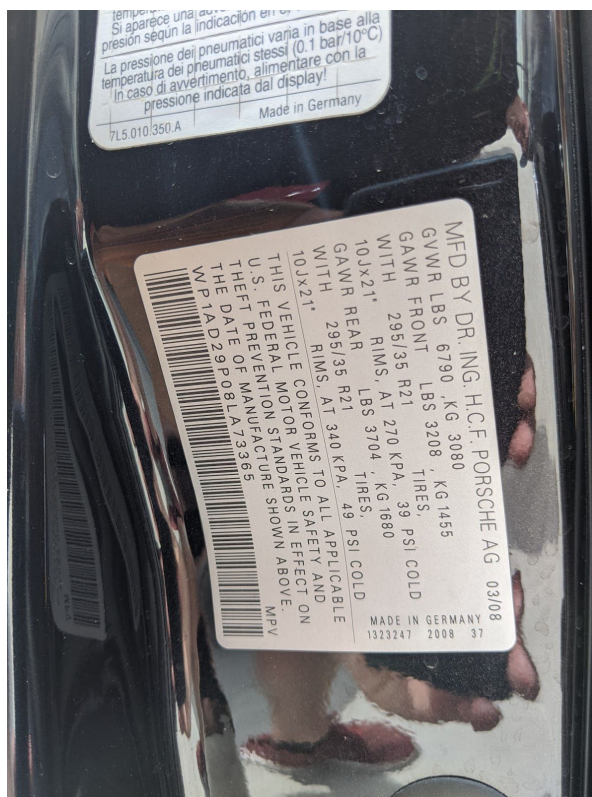

VIN



## Odometer



### Navigation, Heated Seats, and Satellite Radio



Dip stick - Oil clean



Small amount of “blow by” in engine. Oil



analysis ordered.



Service light is on







Manuals







Right Quarter Previous Repair



Right Quarter and Rear Bumper Previous Repairs/Paint Work



Right Quarter Panel Paint



Rear Spoiler - Paint/Clear Faded



Rear Bumper Scuffs





Right Rear Wheel Scratches




Right Front Wheel Scratches/Pitting



Left Front door ding - 1/2"



RF Tire Worn

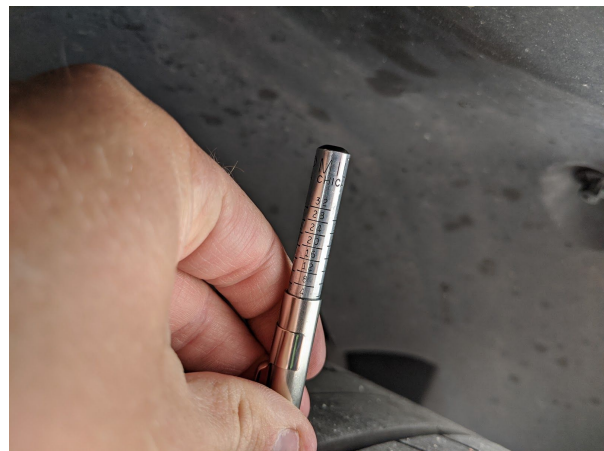

RR Tire Worn





LR Tire Worn



LF Tire Almost worn





## **Checklist**

	Ok	Issue	N/A	Notes
Emission Sticker	X			
Hood struts	X			
Hood insulation	X			
Hood latch operation	X			
Windshield washer level	X			
Inspect Hoses	X			
Check for engine Sludge	X			
Check Oil Level	X			
Inspect Belts	X			
Doors operate correctly	X			
Tailgate/trunk operation	X			
Undercarriage	X			
Truck bed condition			X	
Paint condition		X		Faded spoiler
Windshield and glass condition	X			
Trunk lid closes flush w quarter	X			
Side markers	X			
Headlamps (hi/low beam)	X			
Fog lights	X			
3rd brake light	X			
VIN plate on door jam	X			
Trunk release functions	X			
Front wiper blades	X			
Fuel door release	X			
Door handles operational	X			
Rear wiper and blade		X		Wiper center cap missing
Chrome parts		X		Chrome wheels have pitting
Remote key fob functions	X			
Alarm	X			
Rear window sunshades			X	

Window operation	X			
Door locks	X			
Heated seats	X			
Cooled seats			X	
Auto climate control	X			
AC blows cold/engages	X			
Fresh air mode/outside air	X			
Hazard lights	X			
Gearshift operation	X			
Check engine light	X			
Airbag warning light	X			
Odometer operation	X			
Rear view mirror/compass	X			
Tilt steering functions	X			
Knobs and buttons	X			
Defogger indicator light	X			
Cupholders	X			
ABS light	X			
Radio controls	X			
Navigation functional	X			
Cargo area carpet	X			
Rear seats	X			
Headliner condition	X			
Tire jack and tools	X			
Front seatbelts	X			
Seat position adjusters	X			
Trunk light operational	X			
Liftgate struts	X			
Rear seatbelts	X			
Door sill plates	X			
Headrests function	X			
Rear carpet	X			
Front carpet	X			



Check for engine leaks	X			
Battery is secure	X			
Battery condition	X			
Check for transmission leaks	X			
Check brake fluid level	X			
Inspect radiator hose	X			
Check trans fluid	X			
Check coolant levels	X			
Power steering fluid level	X			
Inspect roof for damage	X			
Frame/unibody	X			
Check for rust	X			
Emblems/badges	X			
Side moldings	X			
Bumpers	X			
Tail lights	X			
Brake lights	X			
Reverse lights	X			
VIN plate on dash	X			
Convertible top operational			X	
Side mirrors	X			
Gas cap condition	X			
Antenna condition	X			
Windows function	X			
Recirculating Air mode	X			
Vent blower speeds	X			
Heater functions	X			
Horn functions	X			
Vanity mirrors	X			
Dome light	X			
Parking brake	X			
Other warning lights	X			
Dash illumination	X			

Dash condition	X			
Clock functions	X			
Backup camera			X	
Battery gauge	X			
Speakers	X			
Owners manual	X			
Weather striping condition	X			
Spare tire	X			
Glove box	X			
Interior trim	X			
Armrest condition	X			
Airbags	X			
Steering wheel centered	X			
Cold/hot starting	X			
Engine operating temp	X			
Check for brake pulsation	X			
Cruise control operates	X			
Steering wheel operation	X			
Shifts smoothly in all gear	X			
Engine idle is normal	X			
Starter functionality	X			
Suspension and handling	X			
Wind noise	X			
Check for rattles	X			
Acceleration	X			
Check for engine smoke	X			
Vibrations or squeaks	X			
Brake noise	X			
Unusual tire noise	X			
Engine Noise	X			
Vehicle tracks straight	X			
Speedometer Functions	X			
Tire condition		X		TIRES WORN

Wheel condition	X			PITTING ON CHROME
-----------------	---	--	--	----------------------

*Oil Analysis Ordered - Results will be sent ASAP*